

Ax and Allies Automotive LLC
5890 Washington St. #8
Denver, Colorado 80216
303-296-0979
INVOICE# 2313 11/9/2022

Page 1

Mileage

Maserati
Bora

Vin

GENERAL WORK

1450.50 Group Total

1@ 20.50 20.50 *LHM Qt
Parts Subtotal 20.50

LABOR 6hrs @110/hr 660.00

*Bora in for replacing brake
accumulators (one of them was from
2001!), getting the parking brake
working better, and replacing the
main accumulator:

Brake spheres - Depressurized car
and braking system and removed both
brake spheres. Endless leaking and
cleaning while they were out. Sent
out to Dave Hume for a rush on both
and re-installed once they arrived.
Bleeding to be done after main
accumulator is replaced. 3hrs

Main accumulator required removing
the under belly pan and an
accessory box that was in the way.
While the pan was out of the way,
it was the time to partially remove
and free up the parking brake
cables and make another adjustment
of the hand brake pads without
interference from the cable.
Fabricated a bushing to install
around the cable housing to give it
some more time before requiring
replacement. Next time though,
bring a cable...

LABOR 4hrs @110/hr 440.00

*** SEE NEXT PAGE ***

Ax and Allies Automotive LLC
5890 Washington St. #8
Denver, Colorado 80216
303-296-0979
INVOICE# 2313 11/9/2022

Page 3

Mileage

Maserati
Bora

Vin

P A Y M E N T S

11/9/2022 3:44 PM CHECK CHK #1134 1450.50

Paid CK CHK #1134

PARTS	20.50
LABOR	1430.00
<< NO TAX >>	
TOTAL	1450.50
Payments	1450.50

Ax and Allies Automotive LLC
5890 Washington St. #8
Denver, Colorado 80216
303-296-0979
INVOICE# 2313 11/9/2022

Page 2

Mileage

Maserati
Bora

Vin

| *Brake spheres: Billed as sublet
| labor to avoid inappropriate
| taxing. Includes rush fee and two
| way shipping.
| **LABOR 3hrs @110/hr 330.00**
| *Brake sphere re-installation:
| Received spheres from Dave Hume and
| installed back on to car. Sort of
| a frustrating puzzle of course.
| Installed accumulator once [REDACTED]
| brought it by and went to pressure
| up car and bleed, but found
| "untouchable" fitting(s) leaking
| once under pressure. Removed for
| whatever fix might be required,
| received call back from Excelsior
| and was told how to proceed.
| Ignored advice and fabricated a
| small brass washer to install under
| the small fitting of the rear most
| sphere to act as a crush washer as
| the steel-on-steel sealing seemed
| inept on Maserati's part.
| Re-installed both spheres after
| tightening ALL of the fittings just
| in case, and then finally pressured
| up and bled. Took for test drive,
| so far so good. Re-installed belly
| pan.

*** SEE NEXT PAGE ***

5890 Washington St. #8
Denver, Colorado 80216
303-296-0979

INVOICE# 2172 5/25/2022

Page 4

Mileage

Maserati
Bora

Vin

| points and found N/A on the rest,
| except for the clutch fluid. Gave
| up on that in favor of not damaging
| the bonnet. :/

P A Y M E N T S

5/25/2022 4:18 PM CREDIT CARD Transaction ID: 370 971.91

Paid CC

PARTS	297.12
LABOR	632.50
SURCHARGE	27.89
TAX	14.40
TOTAL	971.91
Payments	971.91

5890 Washington St. #8
Denver, Colorado 80216
303-296-0979

INVOICE# 2172 5/25/2022

Page 3

Mileage

Maserati
Bora

Vin

| adjustment fine enough to prevent
| the hand brake from becoming
| useless again and future adjustment
| will likely have to be done by
| hand. After getting the pads in
| and the adjusters set up, took car
| for a drive to test. Still
| useless. Put car back up on the
| lift and removed the belly pan to
| expose the cable adjustment. Ran
| that up to it's limit and finally
| the handbrake works as designed,
| which is to say, only after setting
| it with two hands fully committed
| or using a bottle jack under the
| lever. If needed in a panic, just
| skip the attempt so that there is
| more time to enjoy the panic
| process.

| **LABOR 0.75hrs @110/hr 82.50**
| *Changed oil and filter - supplied
| by [REDACTED] Warmed up oil to maximize
| it's effect when being poured over
| the heads of oil changing peasants,
| removed belly pan and made a tool
| to remove the drain plug. After
| that, it was oil change as usual.
| Disposal to follow...
| **LABOR 0.25hrs @110/hr 27.50**
| *Checked / topped off transaxle.
| Went through chart of lubrication

*** SEE NEXT PAGE ***

5890 Washington St. #8
Denver, Colorado 80216
303-296-0979

INVOICE# 2172 5/25/2022

Page 2

Mileage

Maserati
Bora

Vin

| available. Please don't let the
| next shop make too much fun of this
| repair.

| **LABOR 2.75hrs @110/hr 302.50**

| *Complaint of parking brake
| ineffectiveness was investigated as
| though the car were the Khamsin,
| but on THIS car, worn pads and
| adjustment was what was needed. As
| old pads were reasonably worn
| (always the case on this type of
| hand brake caliper) and adjustments
| are always on their last legs, we
| ordered a new set. These of
| course, come with a radiused
| surface making full contact
| impossible until they break in, at
| which point there will be no more
| adjustment left. It's important
| here to remember, you just can't
| win.

| At each wheel, the hand brake
| mechanism (self adjusting,
| supposedly) was dis-assembled and
| freed up and greased to ensure that
| the self adjustment would work,
| then greased for this same purpose.
| It DOES work now, but does not
| adjust to very fine changes in pad
| wear. Doubtful whether or not the
| adjuster mechanisms will keep

*** SEE NEXT PAGE ***

5890 Washington St. #8
Denver, Colorado 80216
303-296-0979

INVOICE# 2172 5/25/2022

Page 1

Mileage

Maserati
Bora

Vin

Left front brake leak / bleed / LOF / parking brake (may be pulley related)

GENERAL WORK				929.62 Group Total
2@	69.21	138.42	Front brake hoses 75679-0Z	LABOR 2hrs @110/hr 220.00
1@	87.50	87.50	Parking brake pads 65987	*Car in to find and fix fluid leak
1@	18.70	18.70	*Shipping	at left front wheel. Found one of
3@	17.50	52.50	LHM / Ltr	the brake hoses was leaking at it's
Parts Subtotal 297.12				crimp, ordered a set but got only
				two for now and replaced them.
				Bled all brakes as air in the
				system seemed possible based on the
				pedal "feel". Copper washers,
				never a problem on ANY other car,
				wouldn't seal on the car's RIGHT
				hand side and the replacement hoses
				as made exit the banjo fitting at
				an odd and un-necessary angle
				making "trial and error" hose
				fitting a requirement to get the
				hoses to lay in a position that
				will not rub on the tire in corners
				or on the coil spring just going
				down the road. Extra deep copper
				washers found on the old hoses
				seemed odd until discovering that
				the banjo bolts are too long to
				seal up the fittings without them.
				Even at that, small concentric
				grooves made the sealing (even
				after the hose orientation
				exorcise) almost impossible. In
				the end, stacking the washers was
				the only fix with what was

*** SEE NEXT PAGE ***

Ax and Allies Automotive LLC
5890 Washington St. #8
Denver, Colorado 80216
303-296-0979

INVOICE# 1667 11/14/2019

Page 1

Mileage

Maserati
Bora

Vin

Free up shift linkage

GENERAL WORK

280.00 Group Total

LABOR	2.8hrs @100/hr	280.00
-------	----------------	--------

*Shift linkage: Car in as shift linkage felt like dragging the lever through molasses. Removed center console as work reported there was coincident with the new and undesirable shifting characteristics. Called previous mechanic and picked his vague memory about what had been done in order to reverse it, but he was unclear. Witness marks suggested that the ball at the base of the lever had been rotated, so we put it back, but symptoms improved only slightly. Removed belly pan (some screws missing as found) and lubricated bushings along side of drive train. This seemed to help a bit as well. At this point, it's probably time to quit!

*** SEE NEXT PAGE ***



11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
10/13/2015	175157

Bill To



Year, Make, Model

1974 Maserati Bora 4.9
Vin#AM117-US 724
Lic#976-ZJC (CO)

Mileage Terms

035,000

Quantity	Item	Description	Rate	Amount
----------	------	-------------	------	--------

brackets for bumper. Fabricate mounting bracket for emblem. Fit new front park / signal lamps. (Bumper, lamps and emblem supplied by customer).
Remove door panels and repair door locks.
Remove and replace speedometer cable.
Fit new LED bulbs to instruments, dash lamps and map lamps.
Replace blower switch as it fell apart when removing the dashboard.
Fabricate and fit engine belly pan with scoops directed at engine.
Remove center console to repair shifter vibration.
Diagnose and repair fuel tank sending unit. Remove sending unit from fuel tank. Replace sending unit float.
Adjust sending unit arm to read more accurately. (Sending unit was reading higher than what was in the tank - tank was less than quarter full and gauge read half.
Remove steering wheel for access to signal switch, repair cancelling mechanism in switch.
Adjust front hood latch.
Remove and replace headlamps with H4 Style head lamps.
Change engine oil and filter. (check old oil for sediment - ok).
Aim head lights.
Check all interior and exterior lamps. Check wipers.
Set tire pressures.
Re check engine oil level.
Re check engine coolant level.
Check climate control, both heat and A/C (ok).
Wash and clean vehicle.

Sales Tax (6.35%) \$519.56

Total \$8,701.55

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date

Invoice #

10/13/2015

175157

Bill To

Year, Make, Model

1974 Maserati Bora 4.9
Vin#AM117-US 724
Lic#976-ZJC (CO)

Mileage

Terms

035,000

Quantity	Item	Description	Rate	Amount
1	spord	Custom Spec Made Aluminum Radiator (Large Capacity) For Bora	1,475.00	1,475.00T
1	Shipping	Shipping & Handling Charges (For Radiator(s))	228.00	228.00T
2	spord	30102157 Puller Fan - Extreme Spal	185.59	371.18T
1	Shipping	Shipping & Handling Charges	25.00	25.00T
1	spord	71560 Speedometer Cable	167.59	167.59T
1	spord	69530 Switch Blower Fan	61.00	61.00T
1	Shipping	Shipping & Handling Charges	17.25	17.25T
1	misc/hardware	Nuts, Bolts, Screws, Washers, Hardware, Foam Tape, Flat Rod, Welding Supply Etc	258.02	258.02T
1	spord	1100-H14 Common Aluminum Alloy Sheet	149.00	149.00T
1	spord	Louvre Strip Aluminum (Pair)	229.95	229.95T
1	spord	HD/CS130 Custom made 160 amp Alternator	385.00	385.00T
1	spord	1592 Oil Filter	23.68	23.68T
12	15w-50	15x-50 Mobil 1 synthetic. Motor Oil	15.03	180.36T
2	spord	GHP6 Green LED Bulb	6.95	13.90T
10	spord	BA9S Cool White LED Bulb	4.95	49.50T
2	spord	3610 Festoon Bulb	6.95	13.90T
1	Shipping	Shipping & Handling Charges	16.18	16.18T
1	spord	C629 Sending Unit Float	15.94	15.94T
9.832	Fuel/gal.	Super Plus Premium Fuel	3.19	31.36T
2	spord	P8039162 Hella H4 Headlamp	87.04	174.08T
2	spord	4B400-5312 Bulb 100/55W	10.55	21.10T
47.5	Labor/Hour	Drain coolant and remove radiator assembly from vehicle. Pack and ship radiator to Griffin to have a larger capacity aluminum radiator fabricated to our measurements. Fit new high flow cooling fans to radiator shroud. Modify radiator shroud to fit thicker radiator (we had to narrow the shroud). Fit and wire high output alternator. Remove existing bumper and fit new euro style front bumper and emblem to vehicle. Fabricate mounting	90.00	4,275.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date

Invoice #

10/13/2015

175157

Bill To

Year, Make, Model

1974 Maserati Bora 4.9
Vin#AM117-US 724
Lic#976-ZJC (CO)

Mileage

Terms

035,000

Quantity	Item	Description	Rate	Amount
1	spord	Custom Spec Made Aluminum Radiator (Large Capacity) For Bora	1,475.00	1,475.00T
1	Shipping	Shipping & Handling Charges (For Radiator(s))	228.00	228.00T
2	spord	30102157 Puller Fan - Extreme Spal	185.59	371.18T
1	Shipping	Shipping & Handling Charges	25.00	25.00T
1	spord	71560 Speedometer Cable	167.59	167.59T
1	spord	69530 Switch Blower Fan	61.00	61.00T
1	Shipping	Shipping & Handling Charges	17.25	17.25T
1	misc/hardware	Nuts, Bolts, Screws, Washers, Hardware, Foam Tape, Flat Rod, Welding Supply Etc	258.02	258.02T
1	spord	1100-H14 Common Aluminum Alloy Sheet	149.00	149.00T
1	spord	Louvre Strip Aluminum (Pair)	229.95	229.95T
1	spord	HD/CS130 Custom made 160 amp Alternator	385.00	385.00T
1	spord	1592 Oil Filter	23.68	23.68T
12	15w-50	15x-50 Mobil 1 synthetic. Motor Oil	15.03	180.36T
2	spord	GHP6 Green LED Bulb	6.95	13.90T
10	spord	BA9S Cool White LED Bulb	4.95	49.50T
2	spord	3610 Festoon Bulb	6.95	13.90T
1	Shipping	Shipping & Handling Charges	16.18	16.18T
1	spord	C629 Sending Unit Float	15.94	15.94T
9.832	Fuel/gal.	Super Plus Premium Fuel	3.19	31.36T
2	spord	P8039162 Hella H4 Headlamp	87.04	174.08T
2	spord	4B400-5312 Bulb 100/55W	10.55	21.10T
47.5	Labor/Hour	Drain coolant and remove radiator assembly from vehicle. Pack and ship radiator to Griffin to have a larger capacity aluminum radiator fabricated to our measurements. Fit new high flow cooling fans to radiator shroud. Modify radiator shroud to fit thicker radiator (we had to narrow the shroud). Fit and wire high output alternator. Remove existing bumper and fit new euro style front bumper and emblem to vehicle. Fabricate mounting	90.00	4,275.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date

Invoice #

6/15/2015

175094

Bill To

Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage

Terms

034,249

Quantity	Item	Description	Rate	Amount
20	Labor/Hour	Refit engine to subframe and transaxle. Prime engine with oil via electric pump. Refit rear subframe assembly to vehicle. Align A/C compressor bracket (before everything was reconnected.) Select better A/C belt as existing one was slightly too long and once A/C compressor belt was tensioned it was sitting close to the side wall of engine compartment. Re connect electrical harnesses, coolant hoses and pipes, etc. Top up cooling system with new fluid and bleed coolant system. Top up engine oil to level. Top up hydraulic system with new LHM mineral oil. Bleed hydraulic system once engine was running.	0.00	0.00T
2.5	Labor/Hour	Disassemble water pump and replace shaft bearing (as requested by customer). Pressure test pump to make sure pump wasn't leaking at seal prior to fitting.	0.00	0.00T
8	Labor/Hour	Run engine & tune. Synchronize dual carburetor throttle flaps (i.e across, the two barrels to each carburetor) Set carburetor idles (rests) so that they are equal. Synchronize carburetor throttles off idle via vacuum / mercury synchronizer.	125.00	1,000.00T
1.5	Labor/Hour	Remove exhaust port probe plugs and set carburetor mixtures to 6.0% CO. Refit probe plugs, air cleaner assembly. Test vehicle to check drivability and for detonation (good).	125.00	187.50T
2	Labor/Hour	Remove and replace signal / wiper switch assembly (part supplied by customer)	0.00	0.00T
		Clean out existing dry cracked urethane around windshield / windshield molding aperture. Mask off molding, roof, glass etc. Apply new sealant. Check all lights, re secure battery, assemble front boot, refit spare tire, engine cover.		
1	Sublet	Detail interior and exterior of vehicle.	200.00	200.00T

Sales Tax (6.35%)

\$1,503.46

Total

\$25,180.02

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
6/15/2015	175094

Bill To



Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage	Terms
034,249	

Quantity	Item	Description	Rate	Amount
8 Labor/Hour		Refit cylinder head studs to block. Refit cylinder heads to engine block with new cylinder head gaskets. Torque cylinder head nuts to correct factory sequence and nut torque. (Fit new left and right timing chains prior installation of cylinder heads). Fit dial indicators to camshafts, and cylinder#1. Time camshafts @TDC, set timing chain tension, rotate engine and recheck. Fit valve covers with new gaskets, rubber half moon seals and new valve cover sealing washers. Fit intake manifold to engine with new sealing rings. Remove carburetor tops, idle jets, emulsion tubes, with air correctors and main jets, pump jets and pump diaphragms. Measure and clean out all jets with jet drills and jet feeler gauges. Reassemble carburetors, check float levels and refit carburetor tops. Refit brackets to engine block for motor mounts, alternator bracket and alternator, hydraulic pump, water pump (new supplied by customer). Refit all belts.	125.00	1,000.00T
6 Labor/Hour		Clean spark plugs, set diode gaps, lube threads and refit. Place ignition distributor in tester to check and reset timing curve. (we had to reset curve because of the raised compression ratio) Disassemble distributor and retest until timing curve and advance were we needed it to be. Fit distributor to vehicle.	125.00	750.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
6/15/2015	175094

Bill To
[Redacted]

Year, Make, Model
1974 Maserati Bora Vin#AM117-US 724

Mileage	Terms
034,249	

Quantity	Item	Description	Rate	Amount
7	Labor/Hour	Disassemble and clean out oil pump pick up screen and pipe, Oil filter house assembly, oil pan, front cover. Install new timing chain guide rails to block and fit new lower timing chain. Install new timing chain tensioner. Refit oil filter house with new sealing rings. Refit front cover with new gasket. Refit all coolant jacket plugs with new seal washers. Refit oil pan with new rope seal, sealant and torque to spec. Fit new rear main seal and front main crankshaft seals. Fit new pilot bearing to crankshaft (even though existing one was good and new).	125.00	875.00T
3.5	Labor/Hour	Fit new light weight flywheel to engine. Align starter so that starter gear and flywheel ring gear mesh perfectly. (after initial installation it was binding and not sounding very pleasant)	125.00	437.50T
3	Labor/Hour	Prep cylinder heads, strip existing finish off valve covers & prep. Refinish cylinder heads and valve covers in wrinkle finish black. Sand off "Maserati" & stripe on valve cover to expose aluminum.	125.00	375.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com




11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
6/15/2015	175094

Bill To

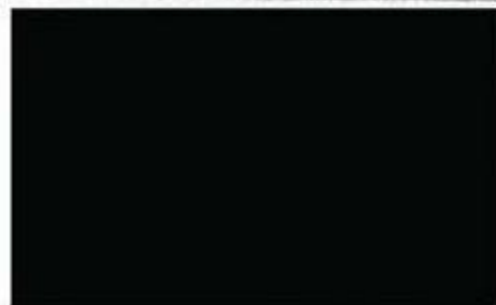

Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage Terms


034,249

Quantity	Item	Description	Rate	Amount
10	Labor/Hour	File and fit piston rings to liner to attain correct piston ring gap clearances. Fit new pistons to connecting rods, with new wrist pins, new wrist pin clips. Install piston rings to pistons, and preset ring gaps to correct clocking.	125.00	1,250.00T
16	Labor/Hour	Power wash engine block and clean out all oil galleries and coolant galleries. Fit bearing caps to engine block, mic' journals for roundness (good, within spec). Remove main bearing caps, fit new main bearings, refit caps and mic' & (compare to measurements taken on crankshaft - done when polished, see above). Fit crankshaft to engine block and torque bolts to spec. Fit new crankshaft thrust washers and measure crankshaft float and set to spec by selecting correct thickness washers. -Disassemble oil pump, check gears for wear, refit gears and check gear clearances (good), reseal and refit to crankshaft & press timing chain sprocket on to crank (this was done before laying the crank in the engine block the final time). Fit piston and connecting rod assemblies to engine (rods and crankshaft were measured already - see above), fit rods to respective cylinders - (they are numbered and refit in the correct direction). Torque connecting rod nuts to spec.	125.00	2,000.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com

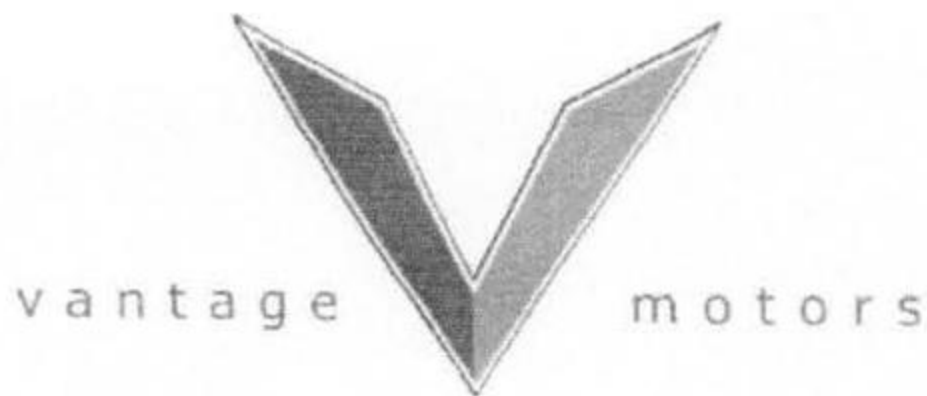

11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
------	-----------

6/15/2015

175094

Bill To



Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage	Terms
---------	-------

034,249

Quantity	Item	Description	Rate	Amount
6	Labor/Hour	Diagnose and repair rattling noise @1500 rpm range. Remove valve covers and reset driver side upper timing chain tension (loose).	125.00	750.00T - No
10	Labor/Hour	Drain coolant and oil from engine. Release electrical harnesses from engine, coolant hoses, fuel hoses, release & remove intake manifold, shifter linkage, axles, A/C compressor, rear valance, rear grill, exhaust system, etc. Remove rear subframe, engine and transaxle from vehicle. Release and remove engine from transaxle and subframe.	0.00	0.00T
8	Labor/Hour	Disassemble engine, remove heads from engine block. Disassemble short block. Remove hydraulic pump, alternator, water pump (failed), remove from crank cover casting, remove oil pan, release connecting rods, main bearing caps and remove crankshaft. Remove timing chain sprocket and oil pump drive from crankshaft. Polish crank (see above).	0.00	0.00T
16	Labor/Hour	Remove piston & connecting rods, remove cylinder head studs, coolant gallery plugs and oil gallery plugs. Wash cylinder heads, clean out oil galleries, coolant galleries, intake and exhaust ports (of media, shavings, etc.) Assemble both cylinder heads with new stainless steel intake and exhaust valves (see above for machining done to heads). Fit camshafts with existing valve shims and take valve clearance measurements. Record measurements, remove camshafts, select correct shims, refit camshafts and recheck measurements. Fit new timing chain guide rails to cylinder heads.	125.00	2,000.00T
8	Labor/Hour	Preheat engine block in hot tank to extract cylinder liners. Clean liner sealing surface and cooling jackets of engine block while liners were removed. Fit new sealing rings to new cylinder liners. Heat block, cool liners and fit to engine block. Hone new cylinders to new pistons (see above)	125.00	1,000.00T

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com



11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
6/15/2015	175094

Bill To



Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage Terms

034,249

Quantity	Item	Description	Rate	Amount
1	spord	50315 O Ring Oil Pump	7.47	7.47T
1	spord	55099 Gasket Oil Pump	4.01	4.01T
1	spord	42693 O Ring Oil Filter House	2.44	2.44T
1	spord	42866 O Ring Oil Filter House	2.44	2.44T
2	spord	46637 Sealing Washer Oil Filter House	1.28	2.56T
2	spord	35569 Sealing Washer Oil Pressure Switch Assy.	0.63	1.26T
1	spord	ML68461 Shaft Bearing	48.10	48.10T
1	spord	63802 O Ring Thermostat Housing	2.44	2.44T
1	spord	64544 Thermostat	59.85	59.85T
1	spord	68560 O Ring Water Pump	3.08	3.08T
1	spord	116007AL Flywheel Aluminum w. Replacement Contact Plate. (Set Includes High Torque Starter Motor)	1,450.00	1,450.00T
1	spord	46424 Pilot Bearing	38.33	38.33T
10	20w50	Eni Agip 20w-50 Motor Oil	7.50	75.00T
1	spord	1622 Oil Filter	21.00	21.00T
2	gal	Antifreeze	19.99	39.98T
4	LHM	LHM Hydraulic Fluid	44.99	179.96T
1	spord	257375 Drive Belt	19.46	19.46T
1	misc/hardware	Nuts, Bolts, Washers, Etc.	49.30	49.30T
1	Paint/Materials	Wrinkle Finish Paint	37.69	37.69T
1	Machine	Measure / Polish Crankshaft Main & Rod Journals / Magnuflux	120.00	120.00T
8	Machine	Measure Connecting Rods / Hone Wrist Pin Bushings to fit new Wrist Pins / Check & Hone Rod Journals	35.00	280.00T
1	Machine	Check Cylinder Heads, Media Blast, Machine Valve Seats. Machine Intake Valve Seats to Fit Larger Intake Valves, Lap valves, & Taper Intake Ports.	950.00	950.00T
1	Machine	Hone New Cylinder Block Liners to Spec for New Pistons	425.00	425.00T
1	Machine	Balance Rotating Assembly, Crankshaft, Connecting Rods, Pistons, Piston Rings, Flywheel & Pressure Plate	300.00	300.00T
15.155	Fuel/gal.	Super Plus Premium Fuel	3.299	50.00T

-7
Finish?

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com




11 Fahey St.
Stamford, CT 06907

Invoice

Date	Invoice #
6/15/2015	175094

Bill To

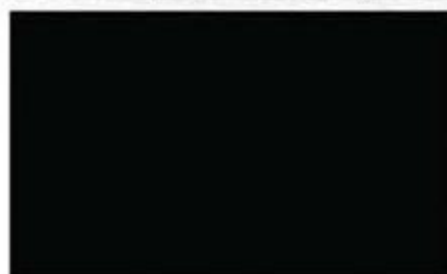

Year, Make, Model

1974 Maserati Bora
Vin#AM117-US 724

Mileage	Terms
034,249	

Quantity	Item	Description	Rate	Amount
2 spord	000055159	Cam Cover Gasket Right	25.50	51.00T
1 spord	000055160	Cam Cover Gasket - Left In	25.50	25.50T
1 spord	000055161	Cam Cover Gasket - Left Ex	25.50	25.50T
8 spord	000055158	Cam End Seal - Half Moon	3.25	26.00T
32 spord	310620364	6mm Sealing Washer - Valve Cover	12.00	384.00T
8 spord	66427	O Ring Intake Manifold to Head	1.98	15.84T
2 spord	65805	O Ring Intake Manifold to Head Cooling Jacket	1.85	3.70T
16 spord	001004	Valve Adjustment Shim	12.00	192.00T
8 spord	112438	Intake Valve - Stainless Steel Large Dia.	55.00	440.00T
8 spord	112188	Exhaust Valve - Stainless Steel	48.00	384.00T
8 spord	63371	Valve Seal Intake	2.24	17.92T
3 spord	000088726	OZ Chain Guide	30.00	90.00T
1 spord	000050525	Timing Chain V8 Lower	168.00	168.00T
1 spord	000050526	Timing Chain Left Upper	198.45	198.45T
1 spord	000050527	Timing Chain Right Upper	198.45	198.45T
1 spord	000050479	Chain Tensioner V8	290.00	290.00T
1 spord	000062823	Cylinder Head Gasket Right	113.87	113.87T
1 spord	000062823	Cylinder Head Gasket Left	113.87	113.87T
1 spord	4.9	Forged Piston Set (8) 10:1 Compression Ratio (inc. Wrist Pins, Total Seal Piston Ring Set)	1,695.00	1,695.00T
4 spord	000066543	Cylinder Sleeve 4.7 / 4.9	191.16	764.64T
4 spord	000066542	Cylinder Sleeve 4.7 / 4.9	191.16	764.64T
3 spord	48052	Sealing Washer Copper - Cooling Jacket	2.45	7.35T
1 spord	33916	Sealing Washer Copper - Cooling Jacket	1.98	1.98T
16 spord	50315	Liner O Ring	8.00	128.00T
1 spord	000061424	116/2/15 Timing Cover Gasket	14.49	14.49T
1 spord	49584	Front Main Seal	24.66	24.66T
1 spord	67795	Rear Main Seal	39.12	39.12T
1 spord	55510	O Ring Auxiliary Shaft	4.09	4.09T
1 spord	000630	Connecting Rod Bearing Set V8 Standard	690.00	690.00T
1 spord	000626	Main Bearing Set V8 Standard	649.00	649.00T
2 spord	479021302	Thrust Washer Upper	40.28	80.56T
2 spord	479021702	Thrust Washer Lower	40.28	80.56T

— No

Sales Tax (6.35%)

Total

Tel: 203-327-1747
Fax: 203-327-7140
www.vantagemotorsports.com

Swain Tech Coatings, Inc.


963 North Road
Scottsville, NY 14546

(585) 889-2786 phone

Packing Slip

Date	Invoice #
7/24/2014	1013661

Bill To

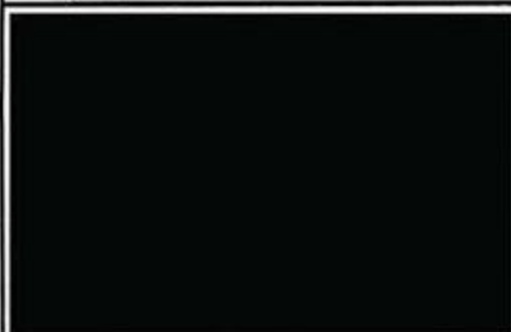

Ship To



P.O. No.	Terms	Ship Date	Ship Via	FOB	Project
	Credit Card	7/24/2014	UPS 2nd Day	Scottsville	
Qty	Item Code	Description	Price Each	Amount	
1	Header 8	8 Cylinder Header / White Lightning	300.00	300.00	
2	Pipe	Pipe / White Lightning	40.00	80.00	
1	Freight	Shipping & Handling	270.24	270.24	
Thank you! We appreciate your business!			Sales Tax ()		\$0.00
			Total		\$650.24



Sheridan, CO 80110

#34977

PHONE

DATE		MODEL		PO#		CSH	CK	CHG
LABOR				PARTS		PRICE		
	R & R RADIATOR	X	R & R BOTH TANKS	185.00				
	R & R HEATER	X	RECORE					
	R & R FUEL TANK		FAN CUT		ASK SPEC CASH :			326.25
	R & R CONDENSOR		REPLACE COOLER					
	R & R MISC.		REPAIR COND.					
	CLEAN		REPAIR EVAP.					
	RODOUT		REPAIR COOLER					
	REPAIR		REPAIR HEATER					
	R & R 1 TANK		REPAIR FUEL TK.					
MISC. LABOR								
				RESALE	TOTAL PARTS	326.25		
				TAX#	TOTAL LABOR	185.00		
				TAX EXEMPT	CITY TAX			
				JOB #	STATE TAX	25.28		
				TECHNICIAN #	RTD TAX			
					TOTAL	536.53		

Thank You

PICKUP ☐
DELIVERY ☐

CUSTOMER SIGNATURE


LiftSupportsDepot.com
1497 Poinsettia Ave. Ste 157
Vista, CA 92081
P:866-969-5438 * F: 760-431-9814
Support@liftsupportsdepot.com
P.O: 100003875

Shipping Method:
SmartPost

[3.2]

Invoice Date: 2014-07-03 19:37:25Z

Shipping Address

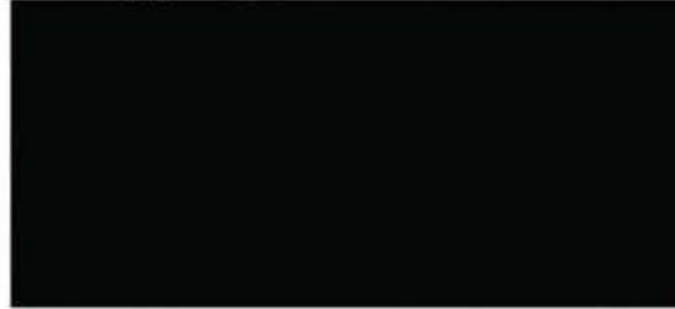

Item
Summary


<u>SKU</u>	<u>Qty</u>	<u>BX</u> <u>Code</u>	<u>Amount</u>
ST300MSS60	N-A 2	36	\$118.00
TDN125M8X125-INX304	E39 4	FR	\$0.00
Coupon			\$0.00
Tax			\$0.00
Shipping & Handling			\$7.36
Invoice Total			\$125.36

Thank you for ordering from Lift Supports Depot.Com.
Please Visit our Website for Installation tips and
suggestions. www.LiftSupportsDepot.com


MIE Corporation

1620 Industry Dr SW Ste F
Auburn, WA 98001
253-833-2598
253-735-0946


Sales Receipt

Work Order #: 33346
Transaction #: 35801
Account #: 
Page: 1 of 1
Date: 7/2/2014
Time: 2:07:43 PM
SLS ID: 5
Register #: 5

Bill To:

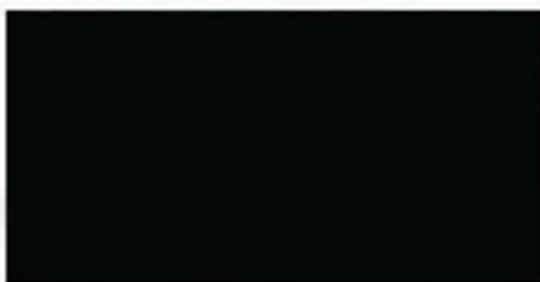

Ship To:

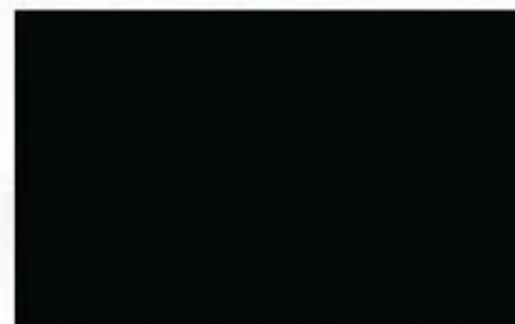


Item Lookup Code	Description	Qty	Retail	Price	Extended
313320172	RADIATOR FAN THERMO SWITCH	2	\$24.27	\$21.85	\$43.70
329888500	129/25/6 SINGLE HOOD STAY	1	\$52.36	\$47.13	\$47.13

This invoice is subject to our Terms & Conditions of Sale. If you did not receive a copy of the Terms & Conditions, please notify us, and we will provide it. Please read it completely.

Thank you for your order!

Sub Total	\$90.83
Sales Tax	\$0.00
FedEx Ground FedEx Ground	\$14.01
525365167624	
Total	\$104.84
Cash Tendered	\$104.84
Credit Card Tendered	\$0.00
Card: XXXXXXXXXXXXX3341	
Exp: 0417	
Auth:	
Roundoff Credit Card	\$0.00
Change Due	\$0.00
Sub Total	\$90.83
Sales Tax	\$0.00
Sub Total	\$90.83

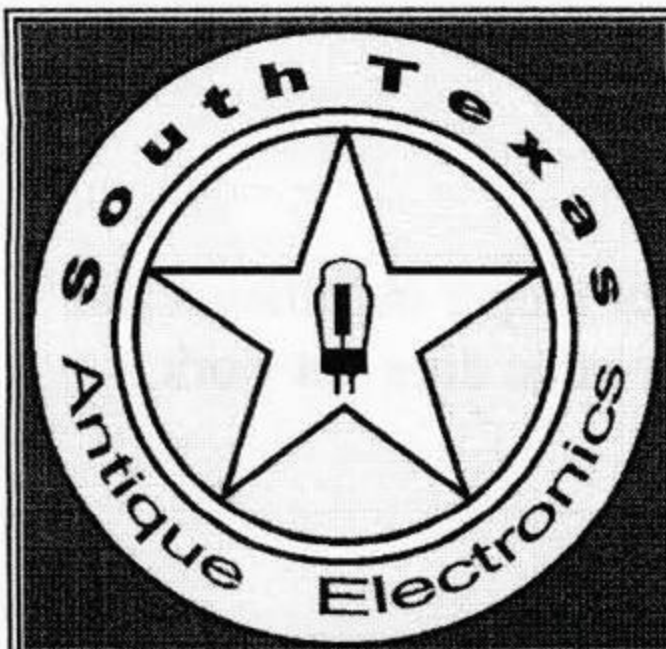

SOUTH TEXAS ANTIQUE ELECTRONICS, LLC

PO Box 1062/516 Lang Road
Portland, TX 78374
(361) 739-4181

email: texas.radios@gmail.com
web: www.SouthTexasAntiqueElectronics.com
Texas Sales Tax Permit No.: 3-20509-3928-2

Customer Information:

Name:	
Shipping address:	
Phone Number/email address:	
Radio Make/Model:	1973 Blaupunkt Bamberg CR

PLEASE SEE INSTRUCTIONS ON REVERSE SIDE

Item		Cost
1	Install FMR-1 conversion board.	\$ 375.00
2	Install BT-1 Bluetooth adapter.	\$ 170.00
3	Integrate cassette player.	\$ 150.00
Paid via PayPal 4/1/2014.		

Invoice number:	14-3-034
Date arrived:	3/19/2014
Date complete:	4/1/2014

Total:	\$ 695.00
Shipping & handling:	\$ 38.86
Sub total:	\$ 733.86
Sales Tax (TX residents only)	\$ -
Grand total:	\$ 733.86

THANK YOU for your business!

THIS IS YOUR INVOICE

INVOICE #

PALO ALTO SPEEDOMETER, INC
Auto Radio & Instrument Service
718 Emerson Street
Palo Alto, CA 94301-2410
(650) 323-0243 FAX (650) 323-4632
www.paspeedo.com
REG.#AD 86482



Name	[REDACTED]			C031188
Address	[REDACTED]			
City	[REDACTED]			
Date	3/25/14	PO #	RO #	Phone

Customer Information

5466-3800-0582-3341 EXP 04/2017
BILLING # OK

PAID 89/xx
\$330.89
APR - 2 2014
Visa

Notes

CALL CUSTOMER WITH OPTIONS
4/2/2014 (9:33AM) EST OK \$295.00 + SHIPPING

PAID VISA

Year & Make	'74 Maserati BORA		VIN #
License No.	Mileage		
Description of Work			Amount
Veglia Borletti elettronico clock w/sec hand #2568 #233204 1 1M w/chrome knob WHINES & RUNS SPORADICALLY. REPAIR OR CONVERT TO QZ **NO COSMETICS; KEEP FACE & BEZEL BUILD QUARTZ CLOCK USING THE ORIGINAL FACE, HANDS, BEZEL, AND LENS			\$295.00
How shipped	FEDEX 2nd Day	Labor	
FedEx #	SIGNATURE REQUIRED OK	Parts	\$295.00
UPS #	4/2/14	Shipping	\$35.89
Insure \$	\$2,000.00	Misc	
		TAX	O/S
AUTHORIZED BY		TOTAL >	\$330.89

ESTIMATES ARE FOR PARTS
AND LABOR

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO VEHICLES PLACED WITH THEM FOR STORAGE, SALE, REPAIR OR WHILE ROAD TESTING.

Invoice

AUTO WEAVE UPHOLSTERY

'European and Antique Interior Restoration'
2613 West 64th Avenue Denver, Colorado 80221
(303) 288-6222 (303) 288-1824
ALL WORK GUARANTEED

Invoice Number:
53303

Page:
1

Invoice To:

Customer Phone:

Invoice Date:

~~03-14-2012~~

03 -

Customer ID	Purchase Order	Payment Terms	Technician
		C.O.D.	ds

Vehicle Color	Vehicle Year	Vehicle Make	Vehicle Model
		Mazz	03-13-14

Quantity	Item	Description	Unit	Unit Price	Extension
3.00	labor	install supplied speakers	hour	60.00	180.00
<div>Paid I full # 4560</div>					

RETURN POLICY

All returns must be made within 7 days. All returns must be in original condition and packaging. No refunds or exchanges on dirty or used goods. No returns on special orders. No return or exchange on electrical goods. All product warranties are the responsibility of the manufacturer - this applies to all automotive accessories and upholstery fabrics. All labor is guaranteed for 1 year from date of installation unless noted otherwise. Returns may be subject to a 15% RESTOCKING FEE. MANUFACTURERS SHALL BE THE SOLE JUDGE OF ALL WARRANTIES.


"I hereby authorize the above repair work to be done along with necessary materials. I FURTHER AGREE THAT IF ANY OBLIGATION FOR SAID REPAIRS, PARTS OR OTHER MATERIALS IS NOT PAID WHEN DUE, OR SUIT IS BROUGHT FOR PAYMENT, I SHALL BE RESPONSIBLE FOR AND SHALL PAY ALL REASONABLE COSTS OF COLLECTION, INCLUDING ATTORNEY FEES, COURT COSTS, AND INTEREST AS PROVIDED BY LAW. In the event of any cost increase the customer will be notified according to state laws. You and your employees may operate the above vehicle for purposes of testing, inspection of delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. I FURTHER CERTIFY THAT I HAVE READ THE ENTIRETY OF THIS AGREEMENT AND THAT I UNDERSTAND EACH OF ITS PROVISIONS. A Storage Charge of \$5.00 Per Day Will Be Charged For Cars Not Picked Up 10 Days After Completion of Repairs.

Taxable Sales	0.00
Non-Taxable Sales	180.00
Subtotal	180.00
Sales Tax	0.00
Total	180.00

MIE Corporation

1620 Industry Dr SW Ste F
Auburn, WA 98001
253-833-2598
253-735-0946


Sales Receipt

Work Order #: 31548
Transaction #: 33956
Account #: 
Page: 1 of 1
Date: 1/15/2014
Time: 3:34:43 PM
SLS ID: 5
Register #: 5

Bill To:



Ship To:

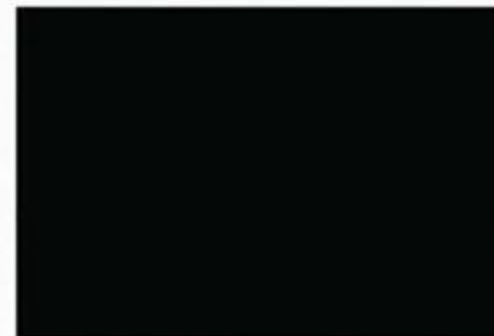

Item Lookup Code	Description	Qty	Retail	Price	Extended
MIE001967	CLUTCH MASTER KIT 0.75" BORE	1	\$28.33	\$25.49	\$25.49
009486400	120/26/38 O-RING	1	\$1.15	\$1.03	\$1.03
000073004-0Z	BRAKE MASTER HOSE - BORA	2	\$39.50	\$35.55	\$71.10
000068082	DASH AIR VENT (NLA)	1	\$120.00	\$120.00	\$120.00


This invoice is subject to our Terms & Conditions of Sale. If you did not receive a copy of the Terms & Conditions, please notify us, and we will provide it. Please read it completely.

Thank you for your order!

Sub Total	\$217.62
Sales Tax	\$0.00
FedEx 2 Day Air 2 Day Air	\$21.30
525365154175	
Total	\$238.92
Cash Tendered	\$238.92
Change Due	\$0.00
Sub Total	\$217.62
Sales Tax	\$0.00
FedEx 2 Day Air 2 Day Air	\$21.30
525365154175	
Total	\$238.92
Sub Total	\$217.62
Sub Total	\$217.62

[REDACTED]		DATE 1-13-14
ADDRESS		
PHONE	EMAIL	
MAKE MASERATI	MODEL BORA	YEAR
VIN #	LIC. #	ODOMETER

Ted's Citroen Service (& STUFF) 303.650.2239

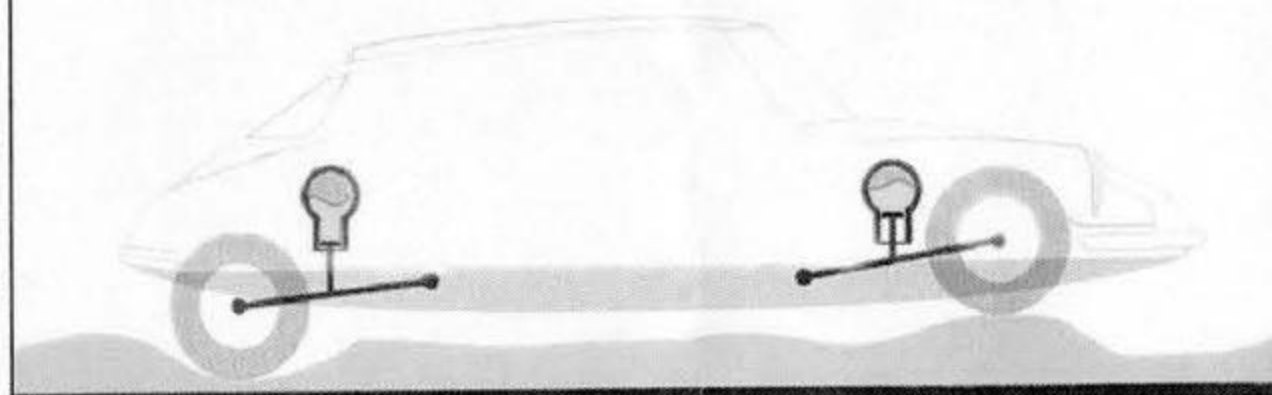


SHOP RATE: 60⁰⁰/hr

INV #

PARTS, MATERIALS, SUBLETS

QTY	DESCRIPTION	PRICE
-----	-------------	-------

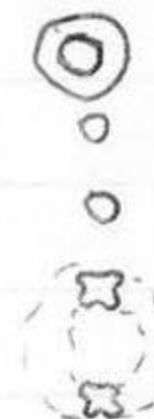

NEED LIST GIRLING 3/4" BORE CLUTCH MASTER KIT

BRAKE VALVE HOSES - 4 SERPENTINE WASHER
REBUILT HYD. SWITCH BLOCK - U-JOINT PACK & SEAL

WISH LIST IDLE JETS TO .6mm

LABOR DESCRIPTION

1-13-14 - ASSES BORA FOR LEAKS & STRATEGIZE REPAIRS ON OTHER ITEMS. SHIM AC COMPRESSOR FOR BELT ALIGNMENT AND TIGHTEN FITTINGS FOR OIL LEAKAGE. CLEAN AREA TO LOOK FOR OTHER LEAKS. FIND LEAKS @ SWITCHES, COMPRESSOR, CLUTCH MASTER, BRAKE VALVE. ADD MISSING NUT TO EX. MANIFOLD.

2-3-14 - KIT CLUTCH MASTER & BLEED. REPLACE HOSE @ TOP REAR OF BRAKE VALVE. INVESTIGATE SEAT SWITCH REMOVAL, FIND EXHAUST RATTLE 5 hrs

4 1/2 hrs
\$270⁰⁰ - PMD #4541

\$300⁰⁰
PMD

TOTAL LABOR

TOTAL PARTS


TOTAL SUBLETS

TAX

INVOICE TOTAL

[REDACTED]		DATE 1-13-14
ADDRESS		
PHONE	EMAIL	
MAKE MASERATI	MODEL BORA	YEAR
VIN #	LIC. #	ODOMETER

Ted's Citroen Service (& STUFF) 303.650.2239

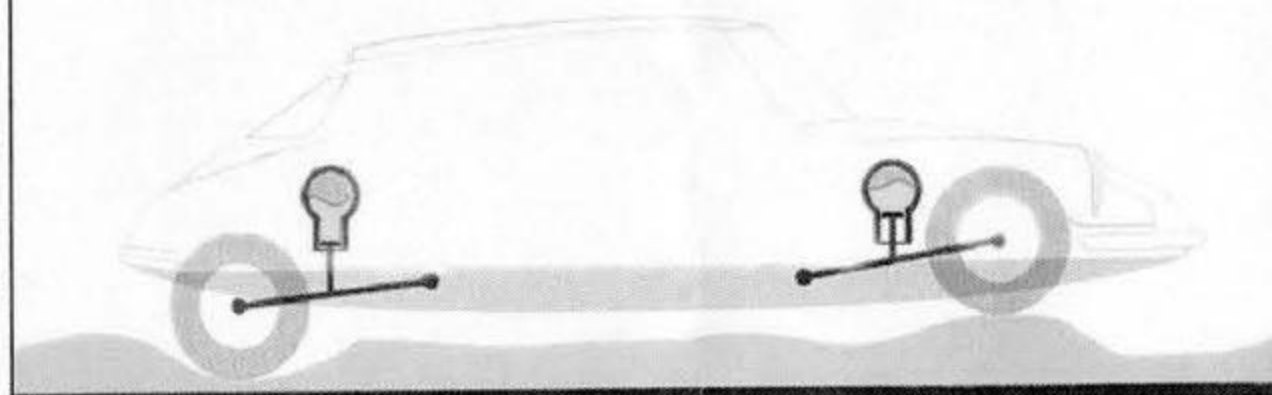


SHOP RATE: 60⁰⁰/hr

INV #

PARTS, MATERIALS, SUBLETS

QTY	DESCRIPTION	PRICE
-----	-------------	-------

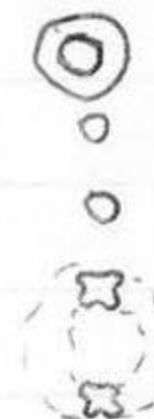

NEED LIST GIRLING 3/4" BORE CLUTCH MASTER KIT

BRAKE VALVE HOSES - 4 SERPENTINE WASHER
REBUILT HYD. SWITCH BLOCK - 4-JOINT PACK & SEAL

WISH LIST IDLE JETS TO .6mm

LABOR DESCRIPTION

1-13-14 - ASSES BORA FOR LEAKS & STRATEGIZE REPAIRS ON OTHER ITEMS. SHIM AC COMPRESSOR FOR BELT ALIGNMENT AND TIGHTEN FITTINGS FOR OIL LEAKAGE. CLEAN AREA TO LOOK FOR OTHER LEAKS. FIND LEAKS @ SWITCHES, COMPRESSOR, CLUTCH MASTER, BRAKE VALVE. ADD MISSING NUT TO EX. MANIFOLD.

2-3-14 - KIT CLUTCH MASTER & BLEED. REPLACE HOSE @ TOP REAR OF BRAKE VALVE. INVESTIGATE SEAT SWITCH REMOVAL, FIND EXHAUST RATTLE 5 hrs

4 1/2 hrs
\$270⁰⁰ - PMD #4541

\$300⁰⁰
PMD

TOTAL LABOR

TOTAL PARTS

TOTAL SUBLETS

TAX

INVOICE TOTAL